



Product Change Notification - SYST-09AMJS720

Date:

13 Aug 2019

Product Category:

Development Tools; Ethernet Switches

Affected CPNs:**Notification subject:**

ERRATA - KSZ8873 Errata Document Revision

Notification text:

SYST-09AMJS720

Microchip has released a new Product Documents for the KSZ8873 Errata of devices. If you are using one of these devices please read the document located at [KSZ8873 Errata](#).

Notification Status: Final

Description of Change: 1) Converted to Microchip format. 2) Module 2: These bits control Force 100," changed to "These bits control Force 100BASE-TX. 3) Module 7: Added new erratum: SMI management interface does not function if SPISN pin is not pulled high 4) Module 8: Added new erratum: Receiver error in 100BASE-TX mode following Soft Power Down.

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 13 August 2019

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachment(s):

[KSZ8873 Errata](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to receive Microchip PCNs via email please register for our PCN email service at our [PCN home page](#) select register then fill in the required fields. You will find instructions about registering for Microchips PCN email service in the [PCN FAQ](#) section.

If you wish to change your PCN profile, including opt out, please go to the [PCN home page](#) select login and sign into your myMicrochip account. Select a profile option from the left navigation bar and make the applicable selections.

Affected Catalog Part Numbers (CPN)

KSZ8873FLL
KSZ8873FLL-EVAL
KSZ8873FLLI
KSZ8873MLL
KSZ8873MLL-AM
KSZ8873MLL-AM-TR
KSZ8873MLL-EVAL
KSZ8873MLLI
KSZ8873MLLJ
KSZ8873MML
KSZ8873MMLI
KSZ8873RLL
KSZ8873RLLI
KSZ8873RLLI-TR
KSZ8873RLLU

KSZ8873 Silicon Errata and Data Sheet Clarification

This document describes known silicon errata for the KSZ8873 family of devices. The silicon errata discussed in this document are for the silicon revisions listed in [Table 1](#). A summary of KSZ8873 silicon errata is provided in [Table 2](#).

TABLE 1: AFFECTED SILICON REVISIONS

Part Numbers	Silicon Revision
KSZ8873FLL, KSZ8873FLLI, KSZ8873MLL, KSZ8873MLLI, KSZ8873MML, KSZ8873MMLI, KSZ8873RLL, KSZ8873RLLI	A2
KSZ8873MLL-AM, KSZ8873RLLU	A3

TABLE 2: SILICON ISSUE SUMMARY

Item Number	Silicon Issue Summary	Affected Silicon Revisions
1.	LinkMD does not work on Port 1	A2
2.	Cannot write certain bits in MIIM Basic Control Register 0	A2
3.	RMII output timing is out of specification (RLL device only)	A2
4.	Port 1 does not respond to received flow control PAUSE frames	A2
5.	The rate for egress port rate limiting is incorrect when tag insertion is enabled	A2, A3
6.	Switch won't start in I2C Master Mode	A2, A3
7.	SMI management interface does not function if SPISN pin is not pulled high	A2, A3
8.	Receiver error in 100BASE-TX mode following Soft Power Down	A2, A3

Silicon Errata Issues

Module 1: LinkMD does not work on Port 1

DESCRIPTION

The LinkMD status result in the register is incorrect for Port 1.

END USER IMPLICATIONS

LinkMD cannot be used for Port 1.

Work around

None.

PLAN

This erratum will not be corrected in a future revision.

Module 2: Cannot write certain bits in MIIM Basic Control Register 0

DESCRIPTION

Bits 8, 12 and 13 in MIIM register 0 (Basic Control Register) cannot be written. These bits control Force 100BASE-TX, Auto-Negotiation and Force Duplex for the PHYs. This applies to both ports 1 and 2.

END USER IMPLICATIONS

These settings can be set at power-up by pin strapping options. However, if using the MIIM interface, these PHY control bits cannot be changed after power-up.

There are copies of these control bits in the 8-bit registers which are accessible via the SMI and SPI interfaces. (See register 0x1C for port 1 and 0x2C for port 2.) There are no problems with writing to these registers.

Work around

Use pin strapping to set the value of these control bits. Use SMI or SPI for register access.

PLAN

This erratum will not be corrected in a future revision.

Module 3: RMII output timing is out of specification (RLL device only)

DESCRIPTION

The maximum output delay (t_{OD}) on the RMII bus is 18ns, which exceeds the specification of 16ns given in the data sheet.

END USER IMPLICATIONS

The increased output delay time reduces the setup time into the connected RMII device. If that setup time is violated, data errors can occur, resulting in errored or dropped packets.

Work around

The following steps can be taken to improve the setup time into the device connected to the RMII port of the KSZ8873RLL:

- Keep the KSZ8873 RMII output data and control signals (RXEN and RXD[1:0]) to the other device as short as possible.
- Do not use an RMII clocking scheme in which the other device sources the RMII 50MHz clock to the KSZ8873. The RMII clock source should be either the KSZ8873 or a separate oscillator.
- If the KSZ8873 is the source of the RMII 50MHz clock, add additional trace delay on the RMII 50MHz clock going into the other RMII device relative to the RXEN and RXD[1:0] traces.
- If an external oscillator is the source of the RMII 50MHz clock, then make the RMII clock trace to the KSZ8873 as short as possible, and add trace delay on the RMII clock going to the other RMII device.

PLAN

This erratum will not be corrected in a future revision.

Module 4: Port 1 does not respond to received flow control PAUSE frames

DESCRIPTION

Port 1 does not respond to received PAUSE control frames. This issue does not affect the generation (transmission) of PAUSE frames by Port 1 in response to congestion within the KSZ8873 switch fabric. Port 2 does not exhibit this issue; it responds properly to received PAUSE frames.

END USER IMPLICATIONS

The switch will not suspend transmission on Port 1 when requested to do so by its link partner sending PAUSE frames. PAUSE frames are received and are counted in the MIB RxPausePkts counter (offset 0xA), but they are not acted upon.

Work around

There is no direct workaround for this issue. However, if Port 1 and Port 2 have different link partners and/or different traffic patterns, it may be possible to assign Ports 1 and 2 with this asymmetry in mind, such that port 1 gets the configuration that is less likely to generate flow control requests into that port.

PLAN

This erratum will not be corrected in a future revision.

Module 5: The rate for egress port rate limiting is incorrect when tag insertion is enabled

DESCRIPTION

When tag insertion is enabled on an egress port and egress port rate limiting is turned on, the egress rate limit will be about twice the programmed value. When tag insertion is disabled, the egress rate limit is as programmed.

END USER IMPLICATIONS

The egress rate may exceed the programmed rate limit if tag insertion is enabled.

Work around

If both features are needed, use an egress rate setting of half the desired rate. However, even with this adjustment, the rate limit control may not be precise.

PLAN

This erratum will not be corrected in a future revision.

Module 6: Switch won't start in I²C Master Mode

DESCRIPTION

In I²C master mode, the switch reads register configurations from an attached EEPROM when exiting reset. In this mode, the Start Switch bit in Register 1 is cleared to '0', which disables the switch.

END USER IMPLICATIONS

After configuration from the external EEPROM, the switch is disabled and cannot be used since I²C master mode implies that there is no other external control of the switch registers.

Work around

When programming the EEPROM, set Register 78 (0x4E) bit 0 = '1'. This corrects the problem.

PLAN

This erratum will not be corrected in a future revision.

Module 7: SMI management interface does not function if SPISN pin is not pulled high

DESCRIPTION

If SPISN (pin 39) is left floating when the MIIM / SMI management mode is selected, the SMI interface will not work. This is due to the internal pull-down resistor on the SPISN pin. The MIIM management mode is unaffected.

END USER IMPLICATIONS

Registers cannot be accessed via SMI management interface if SPISN floats to a low level.

Work around

The problem is solved by pulling SPISN high with an external resistor to VDDIO. Use a resistor value between 1kΩ and 10kΩ.

PLAN

This erratum will not be corrected in a future revision.

Module 8: Receiver error in 100BASE-TX mode following Soft Power Down

DESCRIPTION

Some KSZ8873 devices may exhibit receiver errors after transitioning from Soft Power Down mode to Normal mode, as controlled by register 195 (0xC3) bits [1:0]. When exiting Soft Power Down mode, the receiver blocks may not start up properly, causing the PHY to miss data and exhibit erratic behavior. The problem may appear on either port 1 or port 2, or both ports. The problem occurs only for 100BASE-TX, not 10BASE-T.

END USER IMPLICATIONS

When the failure occurs, the following symptoms are seen on the affected port(s):

- The port is able to link
- LED0 blinks, even when there is no traffic
- The MIB counters indicate receive errors (Rx Fragments, Rx Symbol Errors, Rx CRC Errors, Rx Alignment Errors)
- Only a small fraction of packets is correctly received and forwarded through the switch. Most packets are dropped due to receive errors.

The failing condition cannot be corrected by the following:

- Removing and reconnecting the cable
- Hardware reset
- Software Reset and PCS Reset bits in register 67 (0x43)

Work around

The problem can be corrected by setting and then clearing the Port Power Down bits (registers 29 (0x1D) and 45 (0x2D), bit 3). This must be done separately for each affected port after returning from Soft Power Down Mode to Normal Mode. The following procedure will ensure no further issues due to this erratum.

To enter Soft Power Down Mode, set register 195 (0xC3), bits [1:0] = 10.

To exit Soft Power Down Mode, follow these steps:

1. Set register 195 (0xC3), bits [1:0] = 00 // Exit soft power down mode
2. Wait 1ms minimum
3. Set register 29 (0x1D), bit [3] = 1 // Enter PHY port 1 power down mode
4. Set register 29 (0x1D), bit [3] = 0 // Exit PHY port 1 power down mode
5. Set register 45 (0x2D), bit [3] = 1 // Enter PHY port 2 power down mode
6. Set register 45 (0x2D), bit [3] = 0 // Exit PHY port 2 power down mode

PLAN

This erratum will not be corrected in a future revision.

APPENDIX A: DOCUMENT REVISION HISTORY

Revision Level & Date	Section/Figure/Entry	Correction
DS80000830A (04-10-19)	All	Converted to Microchip format.
	Module 2.	"These bits control Force 100," changed to "These bits control Force 100BASE-TX"
	Module 7.	Added new erratum: SMI management interface does not function if SPISN pin is not pulled high
	Module 8.	Added new erratum: Receiver error in 100BASE-TX mode following Soft Power Down

THE MICROCHIP WEB SITE

Microchip provides online support via our WWW site at www.microchip.com. This web site is used as a means to make files and information easily available to customers. Accessible by using your favorite Internet browser, the web site contains the following information:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQ), technical support requests, online discussion groups, Microchip consultant program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

CUSTOMER CHANGE NOTIFICATION SERVICE

Microchip's customer notification service helps keep customers current on Microchip products. Subscribers will receive e-mail notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, access the Microchip web site at www.microchip.com. Under "Support", click on "Customer Change Notification" and follow the registration instructions.

CUSTOMER SUPPORT

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Field Application Engineer (FAE)
- Technical Support

Customers should contact their distributor, representative or field application engineer (FAE) for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in the back of this document.

Technical support is available through the web site at: <http://www.microchip.com/support>

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, AnyRate, AVR, AVR logo, AVR Freaks, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, Helder, JukeBlox, KeeLoq, Klear, LANCheck, LINK MD, maXStylus, maXTouch, MediaLB, megaAVR, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, Prochip Designer, QTouch, SAM-BA, SpyNIC, SST, SST Logo, SuperFlash, tinyAVR, UNI/O, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

ClockWorks, The Embedded Control Solutions Company, EtherSynch, Hyper Speed Control, HyperLight Load, IntelliMOS, mTouch, Precision Edge, and Quiet-Wire are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, memBrain, Mindi, MiWi, motorBench, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2019, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 9781522443780

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
= ISO/TS 16949 =

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC
Tel: 919-844-7510

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto
Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-67-3636

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820